

# PX161, PX162, PX163, PX164 Pressure Transducers

Operator's Manual: M0260/0698



Signal conditioned pressure sensors are solid state piezoresistive devices. They are ideally suited to applications requiring exact measurement of pressure where the benefits of repeatability, low hysteresis, and long term stability are important. They offer state-ofthe-art benefits of hybrid IC devices, including compactness, ruggedness, and reliability. Computer controlled laser trimming provides close control of important sensor parameters at a lower total cost and higher performance than can be achieved with discrete circuitry. Circuitry to provide temperature compensation is an integral part of each device and is optimized on each unit as part of the calibration procedure. Null and full scale output are similarly controlled. No adjustment or recalibration by the user is required.

#### Soldering

Limit soldering to 315° C (600° F) maximum, with duration of 10 seconds maximum.

#### Cleaning

Proper cleaning fluids should be selected, based on type of contaminant to be removed. OMEGA recommends alcohols or fluorinated solvents.

#### WARNING! Read Before Installation

Fluid hammer and surges can destroy any pressure transducer and must always be avoided. A pressure snubber should be installed to eliminate the damaging hammer effects.

Fluid hammer occurs when a liquid flow is suddenly stopped, as with quick closing solenoid valves. Surges occur when flow is suddenly begun, as when a pump is turned on at full power or a valve is quickly opened.

Liquid surges are particularly damaging to pressure transducers if the pipe is originally empty. To avoid damaging surges, fluid lines should remain full (if possible), pumps should be brought up to power slowly, and valves opened slowly. To avoid damage from both fluid hammer and surges, a surge chamber should be installed, and a pressure snubber should be installed on every transducer.

Symptoms of fluid hammer and surge's damaging effects:

- a) Pressure transducer exhibits an output at zero pressure (large zero offset). If zero offset is less than 10% F.S., user can usually re-zero meter, install proper snubber and continue monitoring pressures.
- b) Pressure transducer output remains constant regardless of pressure.
- c) In severe cases, there will be no output.

#### PX160

PX-160 Series Transducers measures pressure in very low ranges, such as -20 to +120 cm  $H_2O$ ,  $\pm 5$ "  $H_2O$ , 0-10"  $H_2O$ , and 0-27.68"  $H_2O$  (0-1 psi). The gage and differential type sensors feature excellent sensitivity.

The PX160 Series are contained in a thermomoplastic housing. The 0.10" x .020" printed circuit board terminals exit on the opposite side from the ports.

OMEGA Order Number	Housing Number	Туре	Measuring Range – In. H2O	Pressure Port
PX161-027D5V	161PC01D	Vacuum	0-27.68	P <sub>2</sub>
PX162-027D5V	161PC01D	Differential	0-27.68	P1 & P2
PX162-027G5V	162PC01G	Gage	0-27.68	P <sub>2</sub>
PX163-005BD5V	163PC01D36	Bi-Dir Diff.	±5	P1 & P2
PX163-2.5BD5V	163PC01D75	Differential	±2.5	P1 & P2
PX164-005D5V	164PC01D76	Differential	0-5	P1 & P2
PX164-010D5V	164PC01D37	Differential	0-10	P1 & P2
PX163-120D5V	163PC01D48	Differential	-7.87 to 47.24	P1 & P2


# PX160 General Specifications\*

Parameter	Min.	Тур.	Max.	Units			
Parameter Full Scale Output (F.S.O.)** (1) (2)	4.85	5.00 ±2.5	5.15	V			
Null Offset (1) (2)	0.95 3.45	1.00 3.50	1.05 3.55	V			
Output at Full Pressure (3)	5.80	6.00	6.20	V			
Response Time	on the same of the		1	msec			
*Excitation (10 Vdc PX 163-120 D5V)	4.80	8.00	12.00	Vdc			
Supply Current		8.00	20.00	mA			
Output Current Source Sink	10.0 5.0			mA			
Ratiometricity 7 to 8 or 8 to 9 V 8 to 12 V		±0.50 ±2.00		% F.S.O.			
Stability over 1 year		±0.50		% F.S.O.			
Shock	Qualificatio	on tested to 50 G, 11 ms	sec, half sine				
Vibration	Qualification tested to 10 to 2,000 Hz at 10 G sine						
Temperature Compensated Operating Storage	-40 to +85°	C (0 to +145° F) C (-40 to +185° F) ° C (-67 to +257° F)					
Media Compatibility  Cavity Volume $P_1 = 0.081 \text{ in}^3$ $P_2 = 0.0081 \text{ in}^3$	P1: Dry gases only P2: Limited only to those media which will not attack polyester, silicon or silicone based adhesive.						
Weight	28 grams n	28 grams nominal (1 oz.)					
Termination	0.010" x 0.020" nominal printed circuit board terminals						
Output Ripple	None, dc device						
Short Circuit Protection	Output may be shorted indefinitely to ground						
Ground Reference	Supply and Output are common						
*General specification at 8.0 ±0.01 V dc Excitation, 25° C (except for PX163-120D5V at 10.0 ±.01 VDC excitation, 25° C	between er null and fu will vary p	e algebraic difference nd points (output at all pressure). The F.S.O. proportionately with tage (sensor not regulated).	pressi (2) Positi pressi (3) Outp	ve (or negative) ure measurement. ve and negative ure measurement ut at positive egative) pressure.			

PX160 SPECIFICATIONS	Pressure Ranges, Inches H <sub>2</sub> 0						
Parameter Sensitivity: per inch. H20, typ.	±5 0.50	<b>±2.5</b> 1.0	<b>0-5</b> 1.0	<b>0-10</b> 0.50	<b>0-27.68</b> 0.18	<b>-20 to 120</b> cm H <sub>2</sub> 0 0.91	Units V
Linearity (Best Fit Straight Line) P2>P1, max. P2 <p1, max.<="" td=""><td>±1.00 ±0.50</td><td>±1.00 ±0.50</td><td>±1.00 ±0.50</td><td>±1.00 ±0.50</td><td>±2.00 ±1.00</td><td>±0.50 Typ. ±0.50 Typ.</td><td>% F.S.O. % F.S.O.</td></p1,>	±1.00 ±0.50	±1.00 ±0.50	±1.00 ±0.50	±1.00 ±0.50	±2.00 ±1.00	±0.50 Typ. ±0.50 Typ.	% F.S.O. % F.S.O.
Temperature Error, Combined & Sensitivity Shift 25° to 5°, 25' to 45° 25° to -18°, 25° to 63° C, max. 25°, 25° to 85°, typ.	±1.00 	±1.00 - -	±1.00 	±1.00 - -	- ±1.00 ±2.00	±1.25 ±1.25 ±1.25	% F.S.O. % F.S.O. % F.S.O.
Overpressure, max. Repeatibility & Hysteresis, typ.	5 ±0.25	5 ±0.25	5 ±0.25	5 ±0.25	10 ±0.15	350 cm H2O ±0.15% F.S.O.	psi % F.S.O.

## Differential and Gage Types


Gage and differential devices measure one pressure with respect to another. In differential devices, measurands are applied to both ports. In gage devices, P1 is vented to atmospheric pressure and the measurand is applied to P2.

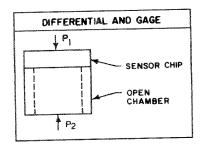


### **Temperature Error**


Temperature error is calculated with respect to 25° C and expresses the deviation that could occur as temperature is raised or lowered to limits indicated.


Typical (as used herein): the error is within  $\pm 1$  standard deviation ( $\pm \delta$ ) of the nominal specified value, as computed from the total population.

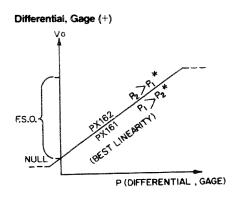

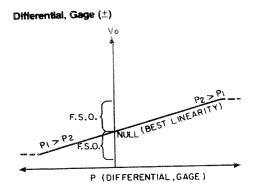

## **ELECTRICAL BLOCK DIAGRAM**

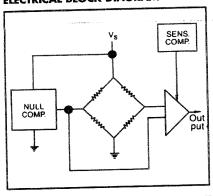


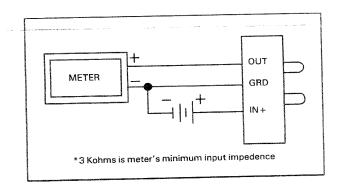

### WARNING

Damage may result from reversal of supply and ground connections.

#### **OUTLINE DIMENSIONS PX160**

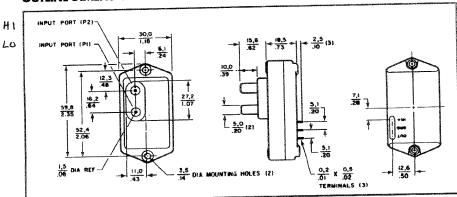



OMEGAnet™ On-Line Service http://www.omega.com

Internet e-mail info@omega.com

Servicing North America:

USA: One Omega Drive, Box 4047 ISO 9001 Certified

Stamford, CT 06907-0047 Tel: (203) 359-1660

e-mail: info@omega.com

976 Bergar

Laval (Quebec) H7L 5A1

Tel: (514) 856-6928 e-mail: canada@omega.com FAX: (514) 856-6886

FAX: (203) 359-7700

For immediate technical or application assistance:

USA and Canada: Sales Service: 1-800-826-6342 / 1-800-TC-OMEGA<sup>5A</sup>

Customer Service: 1-800-622-2378 / 1-800-622-BEST™ Engineering Service: 1-800-872-9436 / 1-800-USA-WHEN™ TELEX: 996404 EASYLINK: 62968934 CABLE: OMEGA

Mexico and

Canada:

Latin America:

Tel: (95) 800-TC-OMEGA<sup>SM</sup> En Español: (203) 359-7803

FAX: (95) 203-359-7807 e-mail: espanol@omega.com Servicing Europe:

Benelux: Postbus 8034, 1180 LA Amstelveen, The Netherlands

Tel: (31) 20 6418405 FAX: (31) 20 6434643

Toll Free in Benelux: 06 0993344

e-mail: nl@omega.com

Czech Republic: ul. Rude armady 1868, 733 01 Karvina-Hranice, Czech Republi

Tel: 420 (69) 6311627 FAX: 420 (69) 6311114

e-mail: czech@omega.com

France: 9, rue Denis Papin, 78190 Trappes

Tel: (33) 130-621-400 FAX: (33) 130-699-120

Toll Free in France: 0800-4-06342 e-mail: france@omega.com

Germany/Austria: Daimlerstrasse 26, D-75392 Deckenpfronn, Germany FAX: 49 (07056) 5540

Tel: 49 (07056) 3017

Toll Free in Germany: 0130 11 21 66

e-mail: germany@omega.com

United Kingdom: 25 Swannington Road, ISO 9002 Certified

Broughton Astley, Leicestershire, LE9 6TU, England Tel: 44 (1455) 285520

Irlam, Manchester, M44 5EX, England Tel: 44 (161) 777-6611 FAX: 44 (161) 777-6622

P.O. Box 7, Omega Drive,

FAX: 44 (1455) 283912 Toll Free in England: 0800-488-488 e-mail: uk@omega.com

It is the policy of OMEGA to comply with all worldwide safety and EMC/EMI regulations that apply. OMEGA is constantly pursuing certification of its products to the European New Approach Directives. OMEGA will add the CE mark to every appropriate device upon certification.

The information contained in this document is believed to be correct but OMEGA Engineering, Inc. accepts no liability for any errors it contains, and reserves the right to alter specifications without notice.

WARNING: These products are not designed for use in, and should not be used for, patient connected applications.

MADE

#### WARRANTY

OMEGA warrants this unit to be free of defects in materials and workmanship and to give satisfactory service for a period of 13 months from date of purchase. OMEGA Warranty adds an additional one (1) month grace period to the normal one (1) year product warranty to cover handling and shipping time. This ensures that OMEGA's customers receive maximum coverage on each product. If the unit should malfunction, it must be returned to the factory for evaluation. OMEGA's Customer Service Department will issue an Authorized Return (AR) number immediately upon phone or written request. Upon examination by OMEGA, if the unit is found to be defective it will be repaired or replaced at no charge. However, this WARRANTY is VOID if the unit shows evidence of having been tampered with or shows evidence of being damaged as a result of excessive corrosion; or current, heat, moisture or vibration; improper specification; misapplication; misuse or other operating conditions outside of OMEGA's control. Components which wear are not warranted, including but not limited to

OMEGA is glad to offer suggestions on the use of its various products. Nevertheless, OMEGA only warrants that the parts manufactured by it will be as specified and free of defects.

OMEGA MAKES NO OTHER WARRANTIES OR REPRESENTATIONS OF ANY KIND WHATSOEVER, EXPRESSED OR IMPLIED, EXCEPT THAT OF TITLE, AND ALL IMPLIED WARRANTIES INCLUDING ANY WARRANTY OF WERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE ARE HEREBY DISCLAIMED.

LIMITATION OF LIABILITY: The remedies of purchaser set forth herein are exclusive and the total liability of ONEGA with respect to this order, whether based on contract, warranty, negligence, indemnification, strict liability or otherwise, shall not exceed the purchase price of the component upon which liability is based. In no event shall OMEGA be liable for consequential, incidental or special damages.

Every precaution for accuracy has been taken in the preparation of this manual; however, OMEGA ENGINEERING, INC. neither assumes responsibility for any omissions or errors that may appear nor assumes liability for any damages that result from th used of the products ina ccordance with the information contained in the manual.

SPECIAL CONDITION: Should thiks equipment be used with any nuclear installationor activity, purhcaser will indemnify OEMA and hold OMEGA harmless form any liablity or damge whatsoever arising out of th use of the equkpment in such a manner.

## RETURN REQUESTS / INQUIRIES

Direct all warranty and repair requests/inquiries to the OMEGA Customer Service Department. BEFORE RETURNING ANY PRODUCT(S) TO OMEGA, PURCHASER MUST OBTAIN AN AUTHORIZED RETURN (AR) NUMBER FROM OMEGA'S CUSTOMER SERVICE DEPARTMENT (IN ORDER TO AVOID PROCESSING DELAYS). The assigned AR number should then be marked on the outside of the return package and on any correspondence.

The purchaser is responsible for shipping charges, freight, insurance and proper packaging to prevent breakage in transit.

FOR WARRANTY RETURNS, please have the following information available BEFORE contacting OMEGA:

- 1. P.O. number under which the product was PURCHASED,
- 2. Model and serial number of the product under warranty, and
- 3. Repair instructions and/or specific problems relative to the product.

FOR **MON-WARRANTY** REPAIRS, consult OMEGA for current repair charges. Have the following information available BEFORE contacting OMEGA:

- 1. P.O. number to cover the COST of the repair,
- 2. Model and serial number of product, and
- 3. Repair instructions and/or specific problems relative to the product.

OMEGA's policy is to make running changes, not model changes, whenever an improvement is possible. This affords our customers the latest in technology and engineering.

OMEGA is a registered trademark of OMEGA ENGINEERING, INC.

© Copyright 1996 OMEGA ENGINEERING, INC. All rights reserved. This document may not be copied, photocopied, reproduced, translated, or reduced to any electronic medium or machine-readable form in what are the copied and the copied of the co